

Mercedes-Benz

or Commercials (Reading)  
se Kiln Lane  
ding  
0JJ  
neuro Express  
:orwen Road  
ding  
shire  
0 4SJ

Reference	J/RYG_RG2/8046	Job/WIP No	33546
Customer Order No:	Unknown	Registration Number	AGILENTRAILER
Asset Number	HPTRAILER	Make/Model	Cartwright Cartwright
Chassis Number	94570	Engine Number	0000000000000
Start Date	2nd February 2014	Fleet Number	Not specified
Odometer	99 kms		

**Safety Inspection, Independent TRAILER Safety Inspection for 'AGILENTRAILER'**  
(ref. 33546)

Key: - ✓ = Serviceable   ✗ = Non Serviceable   ⚠ = Advisory   N/A = Non Applicable

**Trailer Legal** 23rd April 2014

T Test Expiry 31st January 2014

Worksheet Date ✓

Ministry plate position detail

**Trailer Bodywork**

9: General Bodywork  
Technician: Mark Briggs  
Outcome: Advisory  
Free Text: chassis corroded badley in places. ✓

9: Side Guards/Rear Bumper (Check MOT conformity) ✓

**Trailer Fuel/Exhaust/Transmission**

45: Fuel tanks and lines N/A

46: Exhaust system inc Exhaust Manifold Condition and Security N/A

57: Transmission and propeller shafts (including FWD), grease N/A

**Trailer General**

5: Paintwork/Logos ✓

6: Road Wheels and Hubs, Wheel Studs & Nuts ✓

10: Spare Wheel and Carrier N/A

11/12: Trailer Coupling & Rubbing Plate, Wear and Security ✓

14: Wings and Spray Suppression, Mud Guards & Stays ✓

19/20: Body, square on chassis, soundness, security, locking devices, crane support legs, doors, hinges, drop sides, tail boards, floor ✓

MS8: Condition of entrance/Grab handles ✓

42: Electrical Wiring, equipment and switches  
Technician: Mark Briggs  
Outcome: Advisory  
Free Text: cables at rear loose cabled tied up to secure  
Rectification: Advised ✓

62: Rear Marking and Reflectors - position and condition ✓

63: Lamps, position and Function ✓

64: Rear Lamps (position lights/ Fog lamps & Stop/Tail lamps/number plate lamps) ✓

69: ABS/EBS Lamp ✓

65: Side Markers ✓

66: Direction Indicators and Hazard Warning lamps - function ✓

67: Loading Lights ✓

**Trailer Lower**

13: Trailer Landing Legs. Operation, feet, Rockers or wheels ✓

41: Chassis Condition and twist locks, deformation, cracks, corrosion ✓

44: Oil Leaks from Units ✓

48: Shock absorbers, Springs, pins and bushes, security, wear, side play in mounting ✓

50: Attachment of Suspension Units, leaf and coil springs, air suspension, radius arms, torsion bars, bonded suspension units ✓

53: Stub Axles and Hub Bearings & Axles Alignment & Security ✓

52: Steering linkage, Steering Gear, Power Steering - no fouling N/A

36/39: Hand-operated brake control valves - operation, security, corrosion, wear ✓

**Trailer Brakes**


59: Brake wheel units, pipes, reservoirs, valves, connections, actuators, load sensing valve, back plate security. Anti-lock and warning lights ✓

12: Trailer Parking/ Emergency Brakes/ Air Line Connections	✓
Trailer Extras	✓
Grease Up	N/A
Torque Wheel Nuts	N/A
Lubricate Curtains/Ratchets	N/A
Other dangerous defects	

<b>Brake Test Report</b>	
Brake Test Performed?	✓
Outcome: All Brakes Checked and are serviceable	
Service brake performance	N/A
Secondary brake performance	N/A
Parking brake performance	N/A

<b>Tyre Check</b>	
Trailer Details	
Trailer axle 1	265/70 R19.5
Trailer axle 2	265/70 R19.5

**Trailer Tyre Check**

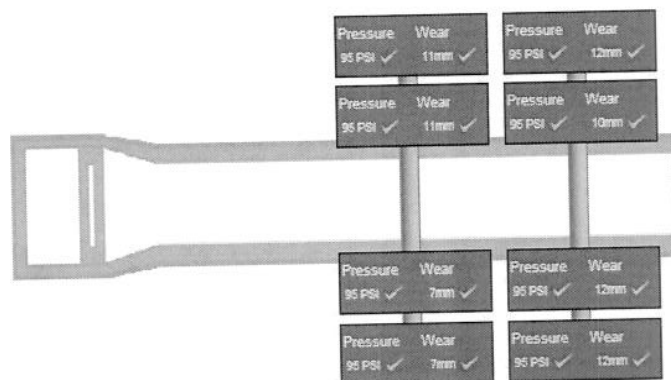

**Trailer axle 1 offside outer**  
 Pressure: 95 PSI  
 Wear: 11mm  
 TMS Condition: OK  
 Brake Linings (% worn as per WS System) or: Non Applicable  
 Brake Linings Visual Check (% worn or mm left): 5 mm remaining on pad

**Trailer axle 1 offside inner**  
 Pressure: 95 PSI  
 Wear: 11mm  
 TMS Condition: OK  
 Brake Linings (% worn as per WS System) or: Non Applicable  
 Brake Linings Visual Check (% worn or mm left): Non Applicable

**Trailer axle 1 nearside inner**  
 Pressure: 95 PSI  
 Wear: 7mm  
 TMS Condition: OK  
 Brake Linings (% worn as per WS System) or: Non Applicable  
 Brake Linings Visual Check (% worn or mm left): Non Applicable

**Trailer axle 1 nearside outer**  
 Pressure: 95 PSI  
 Wear: 7mm  
 TMS Condition: OK  
 Brake Linings (% worn as per WS System) or:

rear axle 2 offside outer

Pressure: 95 PSI

Wear: 12mm

TMS Condition:

OK

Brake Linings (% worn as per WS System) or:

Non Applicable

Brake Linings Visual Check (% worn or mm left):

10 mm remaining on pad

rear axle 2 offside inner

Pressure: 95 PSI

Wear: 10mm

TMS Condition:

OK

Brake Linings (% worn as per WS System) or:

Non Applicable

Brake Linings Visual Check (% worn or mm left):

Non Applicable

rear axle 2 nearside inner

Pressure: 95 PSI

Wear: 12mm

TMS Condition:

OK

Brake Linings (% worn as per WS System) or:

Non Applicable

Brake Linings Visual Check (% worn or mm left):

Non Applicable

rear axle 2 nearside outer

Pressure: 95 PSI

Wear: 12mm

TMS Condition:

OK

Brake Linings (% worn as per WS System) or:

Non Applicable

Brake Linings Visual Check (% worn or mm left):

10 mm remaining on pad

Technician

M. Briggs

Signature: Mark Briggs

Date: 2nd February 2014 21:58:51

Declaration

I certify that the inspection schedule has been completed, the defects listed have not been rectified and in my own opinion the vehicle is in a road worthy condition.

Inspector's Name: Elaine Bamford

Date: 3rd February 2014 11:44:00